



## AVIATION SERVICE DOCUMENT NOTIFICATION

**TO:** Registered Garmin Owner/Operators of GTN 7XX/6XX Units with GTS 8xx Traffic Systems

**DATE:** May 11, 2011

**SUBJECT:** This communication is intended to inform Garmin aviation customers of forthcoming service document Service Bulletin 1126: GTN 7XX/6XX Units with GTS 8xx Traffic Systems.

### **COMPLIANCE**

Recommended

### **PURPOSE**

A GTN software-related issue with GTS 8xx Traffic Systems connected via High Speed Data Bus (HSDB) may cause the relative altitude of traffic targets displayed to be incorrect by a factor of four. For example, traffic targets that are 200 feet below may display as 800 feet below or traffic targets that are 1,000 feet above may display as 4,000 feet above.

### **PRODUCTS AFFECTED**

Model	Garmin P/N	Software P/N	Software Version
GTN 625	011-02254-00	006-B1026-01	2.00
GTN 635	011-02255-00	006-B1026-01	2.00
GTN 650	011-02256-( )	006-B1026-01	2.00
GTN 725	011-02281-00	006-B1026-01	2.00
GTN 750	011-02282-( )	006-B1026-01	2.00

### **DESCRIPTION**

Service Bulletin 1126 provides instructions to disconnect and discontinue use of the HSDB interface to the GTS 8xx Traffic System until this issue is corrected in a future GTN software version.

Please contact your local Garmin Avionics Dealer (<http://www.garmin.com/dealers/>) for additional information or for questions regarding this notification. This service notification and associated bulletin/advisory product changes can only be implemented through Garmin's authorized dealer and service center network. This document is not a substitute for and cannot be used in lieu of the document(s) referenced above for airworthiness approval.